
STANDARD INSTRUMENT DEPARTURES (SID) ESSENDON EIGHT DEPARTURE (RADAR) **MELBOURNE/ESSENDON, VIC (YMEN)**

5 SEP 2024

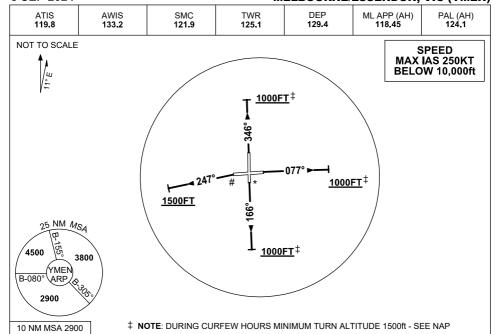

ESSENDON EIGHT DEPARTURE (RADAR)

RWY 08

- GRAD 3.3%
- Track 077°
- At 1000ft ‡BUT NOT BEFORE DER turn to assigned heading or track

RWY 26

- GRAD 3.3%
- Track 247°
- At 1500ft BUT NOT BEFORE DER turn to assigned heading

#CAUTION: FREEWAY AND TRAM SIGNAGE AND LIGHTING UP TO 290ft IN DEP AREA.

RWY 17

- GRAD 3.6% to 1600ft then 3.3%
- Track 166°
- At 1000ft‡BUT NOT BEFORE DER turn to assigned heading or track

*CAUTION: TREES IN RWY 17 DFP ARFA

RWY 35

- GRAD 3.3%
- Track 346°
- At 1000ft ‡BUT NOT BEFORE DER turn to assigned heading or track

COMMUNICATIONS FAILURE PROCEDURE

On recognition of communication failure

- Squawk 7600
- Maintain last assigned vector for two minutes, and
- CLIMB IF NECESSARY TO MINIMUM SAFE ALTITUDE, to maintain terrain clearance, then
- Proceed in accordance with the latest ATC route clearance acknowledged.

airservices australia

Changes: RWY 17 TREES NOTE.