
17 JUN 2021

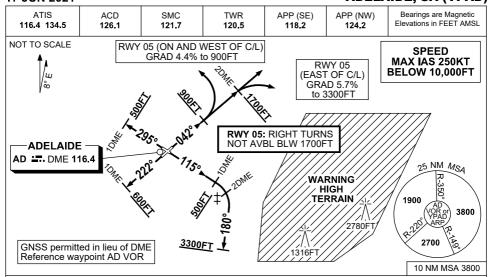

ADELAIDE FOUR DEPARTURE (RADAR)

- NOTE: 1. FOR RWY 05 DEPS, ACFT WITH FLT PLAN TRACKS IN THE SECTOR 042° THROUGH WEST TO 219° CAN EXPECT A LEFT TURN.
 - JETS DEPARTING FROM RWY 23/30 FOR TRACKS TO THE EAST OF ADELAIDE CAN EXPECT TO BE AT OR ABV 5000FT BY CROSSING R-185°AD or THE COAST EASTBOUND
 - WHEN AD DME NOT AVBL, ON PILOT REQ APP WILL ADVISE PASSING DME DIST BASED ON RADAR OBS.

RWY 05 (DEPS EAST OF RWY C/L)

- GRAD 5.7% to 3300FT thence 3.3%
- Track 042°
- AT or ABV 1700FT AND after passing 2 AD DME turn to assigned heading RIGHT TURNS BLW 1700FT NOT AVBL

RWY 05 (DEPS ON & WEST OF RWY C/L)

- GRAD 4.4% to 900FT thence 3.3%
- Track 042°
- AT or ABV 900FT turn LEFT to assigned heading or track

RWY 12 (MAX IAS 175KT until tracking 180°) ±

- GRAD 4.7% to 1500FT thence 3.3%
- Track 115°
- •‡AT or ABV 500FT **AND** between 1 AD DME and 2 AD DME turn RIGHT track 180°
- AT or ABV 3300FT turn to assigned heading

RWY 23

- GRAD 4 7% to 3300FT thence 3 3%
- Track 222°
- AT or ABV 600FT AND after passing 1 AD DME SW turn to assigned heading or track

RWY 30

- GRAD 4.7% to 3300FT thence 3.3%
- Track 295°
- AT or ABV 500FT AND after passing
 1 AD DME NW turn to assigned heading or track

COMMUNICATIONS FAILURE: PROCEDURE IN IMC IF ABLE CTC AD APP 03-9235-2012

On recognition of communication failure

- Squawk 7600
- Maintain last assigned vector for two minutes, and
- · CLIMB IF NECESSARY TO MINIMUM SAFE ALTITUDE, to maintain terrain clearance, then
- proceed in accordance with the latest ATC route clearance acknowledged.

Changes: Editorial. PADDP01-167

