
STANDARD INSTRUMENT ARRIVAL (STAR) HENDO ONE ALPHA ARRIVAL (RNAV CAIRNS/CAIRNS INTL, QLD (YBCS)

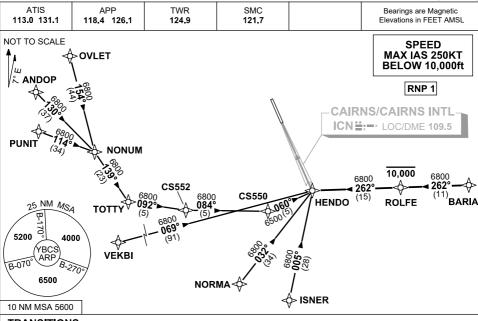

TRANSITIONS:

OVLET: From OVLET to HENDO

Track 154° to NONUM

Turn LEFT, track 139° to TOTTY
Turn LEFT, track 092° to CS552
Turn LEFT, track 084° to CS550
Turn LEFT, track 060° to HENDO

ANDOP: From ANDOP to HENDO

Track 130° to NONUM

Turn RIGHT, track 139° to TOTTY

• Turn LEFT, track 092° to CS552

Turn LEFT, track 084° to CS550
Turn LEFT, track 060° to HENDO

PUNIT: From PUNIT to HENDO

Track 114° to NONUM

Turn RIGHT, track 139° to TOTTY

Turn LEFT, track 092° to CS552

• Turn LEFT, track 084° to CS550

Turn LEFT, track 060° to HENDO

VEKBI: From VEKBI to HENDO

Track 069° to HENDO

NORMA: From NORMA to HENDO

Track 032° to HENDO

From ISNER to HENDO ISNER:

Track 005° to HENDO

From BARIA to HENDO BARIA:

Track 262° to ROLFE

Cross ROLFE AT or BLW 10,000ft

Track 262° to HENDO

FOLLOW ARRIVAL INSTRUCTIONS

ARRIVAL: HENDO ONE

RWY 33 ALPHA: From HENDO track via LOC RWY 33 or RNP Y RWY 33 (AR) approach

COMMUNICATIONS FAILURE: PROCEDURE IN IMC IF ABLE CTC CS ATC ON TEL: (07) 3866 3533

- Squawk 7600, comply with vertical navigation requirements, but not below MSA.
- Track via the latest STAR clearance to the nominated runway, then fly the most suitable approach in accordance with ERSA EMERG Section 1.5.

Changes: REVISED PROC, MSA, VALIDITY INDICATOR, Editorial.

BCSSR05-182

