


**STANDARD INSTRUMENT DEPARTURES (SID)  
SCARP FIVE DEP - RUNWAYS EAST  
PERTH/JANDAKOT, WA (YPJT)**

**23 MAR 2023**

ATIS (AWIS AH) 128.65 281	SMC 124.3	TWR (CTAF+AFRU AH) 118.1	FIA PH CEN 135.25	APP (PH) 123.6 132.95	DEP (PH) 118.7	PAL+AA (AH) 123.9	Bearings are Magnetic Elevations in FEET AMSL
------------------------------	--------------	--------------------------------	----------------------	--------------------------	-------------------	----------------------	--

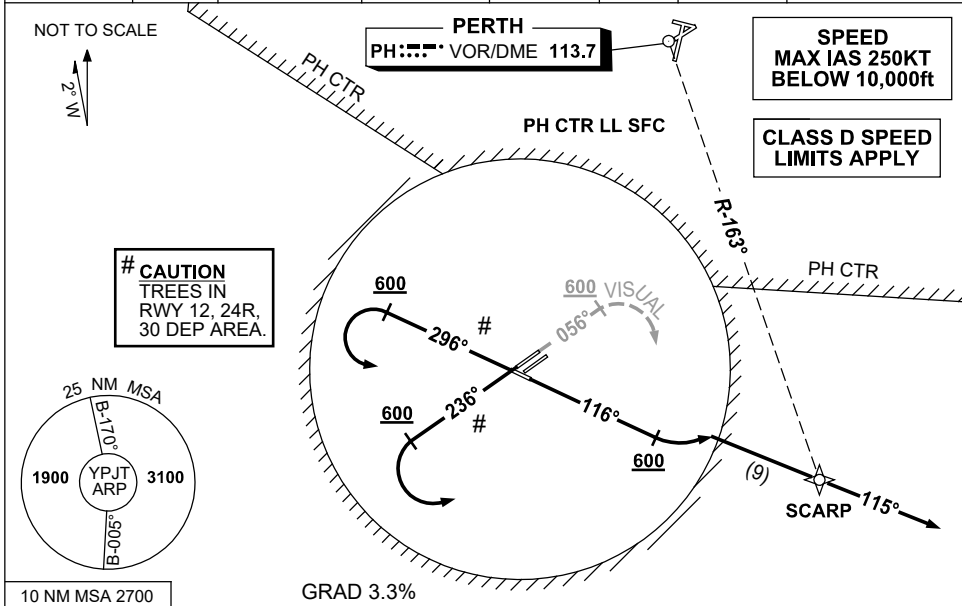

**SCARP FIVE DEPARTURE**

PROC NOT AVBL FROM RWY 06R/24L

**RWY 06L (VISUAL) (RNAV)**

- Track 056°
- After passing 600ft turn RIGHT visually to intercept and track 115° to SCARP
- Continue tracking 115°, thence as cleared

**REQUIREMENTS RWY 06L:**

- Minimum Cloud Base 700ft
- ACFT must remain visual within Jandakot CTR (3NM from ARP) until the end of initial turn.
- Visual segment terminated when established on track to intercept 115° to SCARP.  
Cross JT CTR boundary AT or ABV 700ft.

**RWY 24R (RNAV)**

- Track 236°
- At passing 600ft turn LEFT to intercept and track 115° to SCARP
- Continue tracking 115°, thence as cleared

**RWY 12 (RNAV)**

- Track 116°
- After passing 600ft turn LEFT to intercept and track 115° to SCARP
- Continue tracking 115°, thence as cleared

**RWY 30 (RNAV)**

- Track 296°
- After passing 600ft turn LEFT to intercept and track 115° to SCARP
- Continue tracking 115°, thence as cleared

**COMMUNICATIONS FAILURE PROCEDURE**

On recognition of communications failure

- Squawk 7600
- Maintain procedure track for two minutes, and
- CLIMB IF NECESSARY TO MINIMUM SAFE ALTITUDE, to maintain terrain clearance, then
- Proceed in accordance with the latest ATC route clearance acknowledged.

Changes: CHART TITLE, RQNMNTS NOTES, REF TO JT NDB REMOVED, MSA.

PJTDPO1-174