
# SCHERGER (RAAF) AVFAX CODE 4507

**FLFV 145** 

QLD UTC +10 YBSG 123726S 1420514E VAR 5 DEG E MIL

AD OPR RAAF, Airbase Operations Centre - RAAF Base Townsville, QLD, 4814. Email: tvl.aboc@defence.gov.au. PH 07 4752 1888.

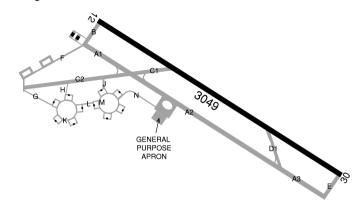

#### REMARKS

- All ACFT require H24 PN to RAAF Base Townsville ABOC. PN and support REQ to be made through PH 07 4752 1888 or 0418 405 948 or via email.
- INTL RAAF FLT are not to plan to enter Australia THRU Scherger WO approval of Department of Customs and Australian Quarantine and Inspection Service (AQIS), EXC in an EMERG.

# HANDLING SERVICES AND FACILITIES

AVBL via NOTAM.

## RESCUE AND FIREFIGHTING SERVICES

AVBL via NOTAM.

## **APRONS AND TAXIWAYS**

- RWY and TWY shoulders non-compliant for Code D and Code E ACFT. Reduced WID and edge clearance for Code D ACFT on TWY C1 and D1. TWY edge drops greater than 25mm in areas on TWY A1, A2, A3, C1 and D1.
- 2. TWY markings non-compliant. C17A ACFT and larger to TAX at 5KT at TWY INT.
- TWY A1, A2 and A3 AVBL as EMERG RWY.
- 4. RWY HLDG PSN markings and lighting on TWY B, C1 and D1 non-compliant.
- Non-STD TWY naming conventions.

#### AERODROME OBSTACLES

IWI at both thresholds penetrate OLS. Not frangible or frangibly mounted. Not visible at night.

# METEOROLOGICAL INFORMATION PROVIDED

- 1. METAR/SPECI.
- 2. AWIS PH 07 3564 3737 Report faults to 07 4082 3070.

#### PHYSICAL CHARACTERISTICS

12/30 117 100a PCN 46 /F /B /1750 (254PSI) /T WID 45 RWS 150 Arrestor system not permanently installed. Units requiring hookcable are to provide system and crew.

# **AERODROME AND APPROACH LIGHTING**

RWY 12/30 MIRL PAL+AA 120.6 SDBY PWR AVBL RWY 12/30 PAPI PAL+AA 120.6 3.0 DEG48FT SDBY PWR AVBL RWY 12/30 RTIL PAL+AA 120.6 SDBY PWR AVBL

1. DIST to run markers lit.

2. PWR supplied by generator on base.

RWY edge LGT and PAPI not AVBL EXC with 24HR PN to RAAF Base Townsville ABOC via email.

# ATS AND AERODROME COMMUNICATION FACILITIES

FIA BRISBANE CENTRE 122.1 Circuit Area

TWR. SMC and ATIS availability and HR of service promulgated by NOTAM.

#### RADIO NAVIGATION AND LANDING AIDS

TAC SGR 123710.9S 1420520.0E (1)

(1) PTBL FAC ACT as required by MIL authorities. Channel assignment and ACT by NOTAM.

### LOCAL TRAFFIC REGULATIONS

180 DEG turns on RWY not permitted for ACFT with outer main gear wheel span greater than 9M.

#### **FLIGHT PROCEDURES**

# REMOTELY PILOTED AIRCRAFT SYSTEM (RPAS)

All RPAS requests and enquiries are to be sent to adf.airspace@defence.gov.au with at least 5 business days PN. OPS are subject to MIL OPS and may be restricted or cancelled at any time.

#### **CTAF** 126.7

Except when Scherger CTR and Restricted areas active.

### ADDITIONAL INFORMATION

- Animal hazard exists.
- Two-way COM BTN ACFT on the ground at Weipa and Scherger on CTAF may be prevented by terrain shielding.

#### CHARTS RELATED TO THE AERODROME

- WAC 3112.
- 2. MIL Aerodrome Obstruction Chart Type A: MAY 2018.